

Reference Specifications

No: 01100118

PN72 INCREMENTAL

Ver. 3.0 Page 1/11

1. PN72 Incremental Optical Encoder (Hollow Shaft)

1.1 Introduction:

PN72 with its unique through-shaft concentric locking device, double-bearing large-aperture ultra-thin design, flexible spring plate installation, and protection grade IP50, can solve the installation problems of low space limitations and slight axial movement of the motor shaft.

1.2 Feature:

- Encoder external diameter Ø72mm thickness min 15mm diameter of shaft up to Ø30mm;
- · Adopt non-contact photoelectric principle;
- · Reverse polarity protection;
- · Short circuit protection,
- · Multiple electrical interfaces available;
- Resolution per turn up to 10000PPR.

1.3 Application

Servo motor, robot and automation control fields.

- 1.4 Connection:
 - Radial socket (8P & 14P)
 - Radial cable (standard length 1.0M)
- 1.5 Protection: IP50
- 1.6 Weight: About 200g










PN72-J



2. Model Selection Guide

2.1 Model composition(select parameters)

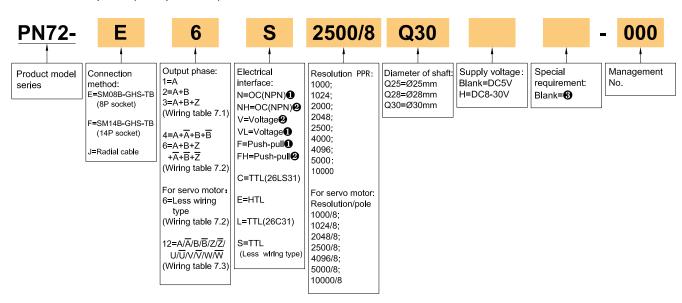


- 2. 2 Note
- 1. Z signal is low level active.
- 2. Z signal is high level active.
- Blank means IP50, cable length is 1.0M, if need to change the length C+number, the longest is 100M (expressed by C100). For the specific length of use, pls refer to page P2 -P3 of the provision of output circuit.

Ver. 3.0 Page 2/11



3. Output Method

3.1 Incremental signal

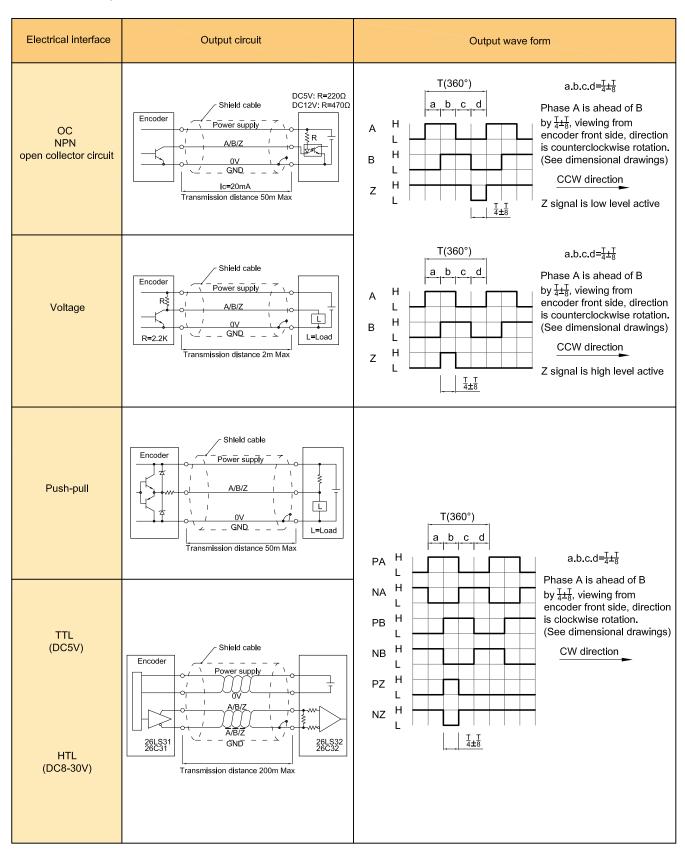



3.2 For servo motor(with UVW)

Electrical interface	Output circuit	Output wave form
TTL (DC5V)	Shield cable Fower supply O ABIZ ABIZ 26LS31 26LS31 26LS32 26C32 Transmission distance 200m Max	A B Z 7/4 7/4 7/4 7/4 7/4 7/4 7/4 7/4 7/4 7/4
TTL (DC5V) (Less wiring type)	No. Function Mode Color 1 2 3	Reverse signal not shown pole g.h.j.k.m.n r 6 20±1° 120° 8 15±1° 90° 16 7.5±1° 45° a.b.c.d=\frac{1}{4} ± \frac{1}{8} e=T ± \frac{1}{2} f: center of phase Z to rise point of phase U,that is ±1° CW direction \to CW direction Viewed from encoder front side direction is clockwise rotation. (See dimensional drawings)

INCREMENTAL

Ver. 3.0 Page 4/1



4. Electrical Parameter

Parameter Output type			ос	Voltage	Push-pull	TTL	TTL (Less wiring type)	HTL				
Supply voltage			DC+5V±5%; DC8V	/-30V±5%		DC+5V±5%	DC8-30V±5%					
Cor	nsumptior ent	1	100mA Max			120mA Max						
Allo	wable rip	ple	≤3%rms									
Top	respons uency	е	100KHz			300KHz		500KHz				
	Output	Input	≤30mA	Load resistance	≤30mA	. ≤±20mA		≤±50mA				
acity	current	Output	_	2.2K	≤10mA	SIZUIIA		=±50IIIA				
Output capacity	Output	"H"	_	_	≥[(Supply voltage) -2.5V]	≥2.5V	≥Vcc-3 VDC					
ontpu	voltage	"L"	"L" ≤0.4V ≤0.7V(less than 20mA)		≤0.4V(30mA)		≤1V VDC					
	Load vol	tage	≤DC30V	1		_						
Ris	e & Fall ti	me	Less than 2us(cabl	e length: 2m)		Less than 1us(Cable length: 2m)						
Insu	lation str	ength	AC500V 60s									
	lation stance		10ΜΩ									
Mar	k to space	e ratio	45% to 55%									
pro	erse pola tection	arity	~									
Short-circuit protection —					~0							
	Phase shift		90°±10° (frequency in low speed)									
betv	ween A &	В	90°±20° (frequency in high speed)									
Dela time	ay motion e 2		_				510±220ms	_				
GNI)		Not connect to encoder									

- ① Short-circuit to another channel or GND permitted for max.30s.
- 2 Phase A.B.Z are back of phase U.V.W when power on.

PN72 INCREMENTAL

Ver. 3.0 Page 5/11



Diameter of shaft	Ø25mm; Ø28mm; Ø30mm(optional)						
Starting torque	Less than 60×10 ⁻³ N⋅m						
Inertia moment	Less than 80×10 ⁻⁶ kg·m²						
Shaft load	Radial 50N; Axial 30N						
Slew speed	≤5000 rpm						
Bearing Life	1.5X10 ⁹ revs at rated load(100000hrs at 2500RPM)						
Material	Base: Die cast aluminum						
Weight	About 200g						

6. Environmental Parameter

Environmental temperature Operating: -20~+85°C(repeatable winding cable: -10°C); Storage: -20~+90°C							
Environmental humidity Operating and storage: 35~85%RH(noncondensing)							
Vibration(Endurance)	durance) Amplitude 0.75mm,5~55Hz,2h for X,Y,Z direction individually						
Shock(Endurance) 980m/s² 11ms three times for X,Y,Z direction individually							
Protection	IP50						

PN72 INCREMENTAL

Ver. 3.0 Page 6/1



7. Wiring Table

7.1 OC / Voltage

			Signal				Supply voltage		
Socket pin No.	1	2	3	4	5 6		7	8	
Wire color	White	=	Green	-	Yellow	-	Red	Black	
Function	А	-	В	-	Z	1	Up	0V	

7.2 TTL / HTL / Push-pull / Less wiring type

			Sig	nal			Supply voltage	
Socket pin No.	1	2	3	3 4		6	7	8
Wire color	White White/BK		Green Green/BK		Yellow	Yellow/BK	Red	Black
Function	A+ (U+)* A- (U-)*		B+ (√+)* B- (√-)*		Z+ (\/\/+)*	Z- (\/\-)*	Up	0V
Twisted-paired cable								

^{*} For the functional status in less wiring mode, refer to the functional mode wiring table for output circuit on page 3.

7.3 For servo motor

				Incremental signal								Supply voltage		
Socket pin No.	1	2	3	4	5	6	7	8	9	10	11	12	13	14
Wire color	Grey	Grey/Bk	Blue/Bk	Blue	Pink/Bk	Pink	Yellow	Yellow/BK	Green	Green/BK	White	White/BK	Black	Red
Function	V+	V-	U-	U+	W-	W+	Z+	Z-	B+	B-	A+	A-	0V	Up
Twisted- paired cable														


Up=Supply voltage.

Shield wire is not connected to the internal circuit of encoder.


Ver. 3.0 Page 7/11



8.1 Socket pin definition

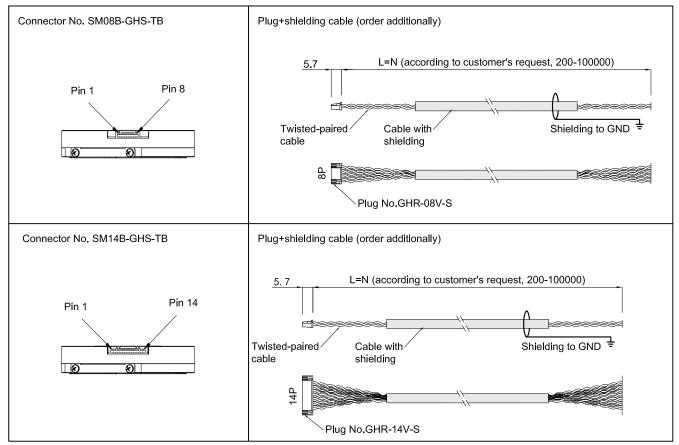

8. 2 Radial Cable Schematic

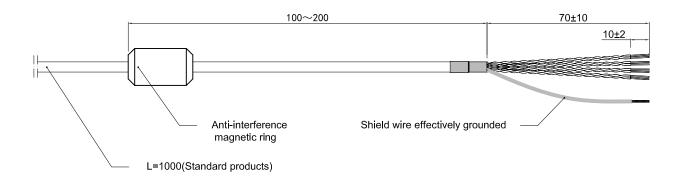



Unit: mm


Ver. 3.0 Page 8/1'

9 Basic Dimension


9.1 PN72-E (8P socket)

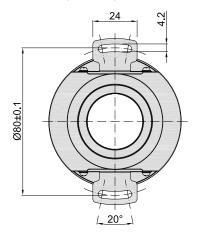

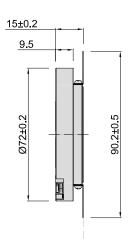

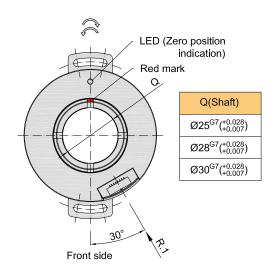



9.2 PN72-F (14P socket, other dimension are the same as PN72-E)

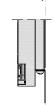

Range Park

9.3 PN72-J (radial cable, other dimension are the same as PN72-E)

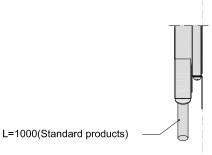

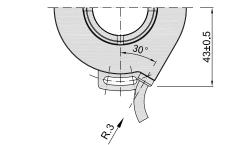



9.4 Installation shaft specification

d(motor shaft)
Ø25 _{g6} (-0.007)
Ø28 _{g6} (-0.007)
Ø30 _{g6} (-0.007)

Mounting screws

Inner hexagon bolt +flat washer Specification: M4*6 Material: stainless steel Quantity: 2

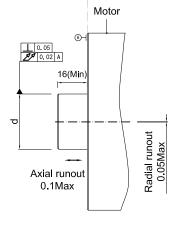

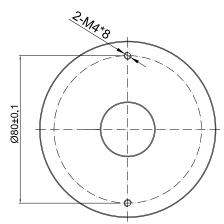

Unit: mm



⇒ = Shaft rotate direction of incremental TTL & HTL signal output

Shaft rotate direction of OC signal output

R1 = Radial socket 8P (SM08B-GHS-TB).

R2 = Radial socket 14P (SM14B-GHS-TB).

R3 = Radial cable(standard length 1M).

Ver. 3.0 Page 9/1

10. Encoder Assembly Steps


10.1 Installation and zero alignment steps of servo dedicated with U.V.W

Step 1

- a. Before installing the encoder, first to confirm the starting zero position of the motor and lock it tightly to ensure that the motor shaft is not moving until the encoder is finished installation, otherwise the encoder and the motor's zero position cannot be aligned.
- b. Put the encoder (2) directly on the motor shaft and gently push it to the motor platform by hand.
- Screwed the two M4*6 bolts (3) at the same time, but do not tighten, just enough to rotate the encoder by hand.

Note:

Please refer to page 8 for the matching tolerance of the encoder shaft sleeve and the motor shaft.

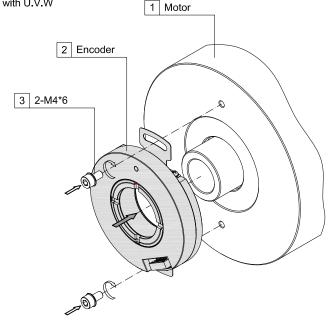


Step 2

- a. Fix the spanner (A) on the slot of the encoder shaft sleeve (outer ring) and then use the spanner (B) to tighten the lock nut (recommended tightening force is 15-20N.m).
- b. Pls refer to the cable connection table on page 6-7, power on after checking all are correct, please confirm again that the motor is in the zero locked state, and then turn the encoder (2) left and right by hand, observe the LED on the encoder, when it is on, the zero signal is aligned, then tighten the two M4*6 bolts (3) and keep the LED on.

Note:

- *. The red mark on the shaft sleeve is always aligned with the LED indicator.
- *. After making sure that the lock nut has been tightened, put thread glue on the inner thread of the slot to prevent the screw from loosening.
- *. Because the width of the zero signal is relatively narrow, it is easy to cause displacement during the tightening process and the LED may not light up. please be patient to debug or use other testing equipments as auxiliary observation.

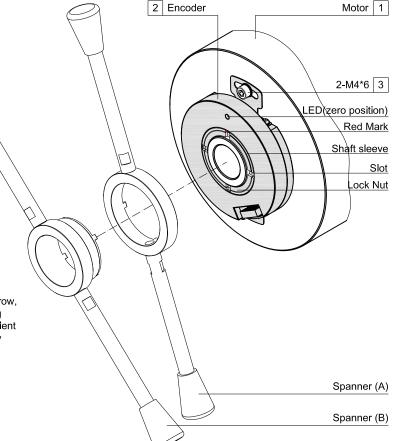


10. 2 Incremental signal encoder installation steps

Step 1

Put the encoder (2) directly on the motor shaft (1) and gently push it to the motor platform, then tighten the two M4*6 bolts (3) at the same time.

Note:

Please refer to page 8 for the matching tolerance of the encoder shaft sleeve and the motor shaft.

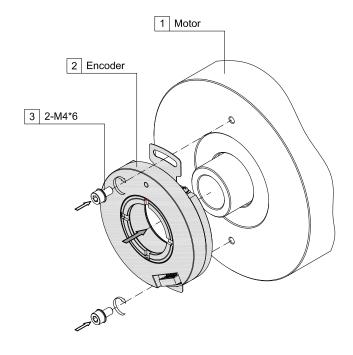


Step 2

Fix the spanner (A) on the slot of the encoder shaft sleeve (outer ring) and then use the spanner (B) to tighten the lock nut (recommended tightening force is 15-20N.m).

Note:

- *. The red mark on the shaft sleeve aligned with the LED indicator is regarded as the zero primary position, when the LED light is on, this will be the final precise zero position.
- * After making sure that the lock nut has been tightened, put thread glue on the inner thread of the slot to prevent the screw from ioosening.

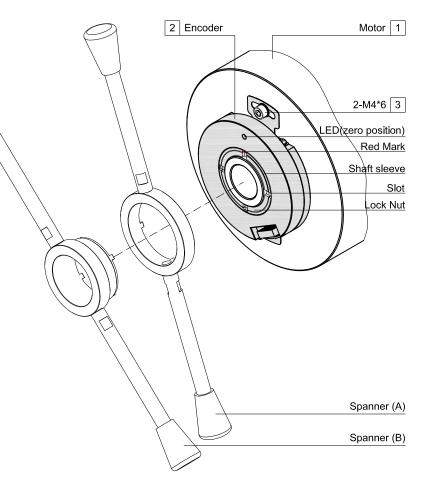

PN72 INCREMENTAL

Ver. 3.0 Page 11/11

11 Caution

11.1 About vibration

Vibration act on encoder always cause wrong pulse, so we should pay attention to working place. More pulse per revolution, narrower groovy spacing of grating, more effect to encoder by vibration, when rev is low or stop, vibration act on shaft or main body would cause grating vibrating, so encoder might make wrong pulse.

11.2 Caution for wiring

- Use the encoder under the specified supply voltage. Please note that the supply voltage range may drop due to the wiring length.
- Do not put the encoder wiring and other power lines through the same duct, and do not use them by bundling in parallel.
- Please do not apply excessive force to the cable of encoder, or it will may be damaged.

